PN-ABW-793
NOT FOR PUBLICATION OR DISTRIBUTION 96342

ENVIRONMENTAL ASSESSMENT REPORT

Zambia Steel and Building Supplies Limited, Door Factory Facility Kapatu Road Lusaka, Zambia

Date Assessed: May 15, 1995

Prepared for the ZAMBIA PRIVATISATION AGENCY

Prepared by P H ASSOCIATES, INC.

July 28, 1995

TABLE OF CONTENTS

1. INTRODUCTION	. 1
1.1 Background	. 1
2. SCOPE OF WORK	. 3
3. METHODOLOGY	. 4
3.1 Ministry Records Reviews and Interviews	. 4
3.2 Environmental Regulations	. 4
3.3 Aerial Photographs	. 5
3.4 Facility Site Reviews	. 5
3.4.1 Site Visits	. 6
3.4.2 Facility Records	. 6
3.4.3 Interviews	. 6
4. RESULTS OF ENVIRONMENTAL ASSESSMENT	. 7
4.1 Facility Ministry Records	. 7
4.2 Aerial Photographs	. 7
4.3 Facility History and Records.	. 7
4.4 Site Activities and Processes.	. 7
4.5 Environmental Setting	. 8
4.5.1 Topography	. 8
4.5.2 Geology	. 8
4.5.3 Hydrogeology	. 8
4.6 Field Reconnaissance Results	. 9
4.6.1 Utilities	. 9
4.5.1.1 Electricity	. 9
4.6.1.2 Water Supply	. 9
4.6.1.3 Sanitary Sewer	. 9
4.6.1.4 Stormwater Control	. 9
4.6.2 Structures	10
4.6.3 Environmental Effects and Observations	10
4.6.3.1 Chemicals, Petroleum, and Process Materials	10
4.6.3.2 Process Waste Streams	11
4.6.3.3 Air Emissions	11
4.6.3.4 Pesticide/Herbicide Use	11
4.6.3.5 Underground/Aboveground Storage Tanks	11

	4.6.3.6 Rele	eases/Spill Controls	11
	4.6.3.7 Pote	ntially Hazardous Materials	12
4.6.3.8 Waste Disposal			12
4.7	Applicable Enviro	nmental Regulations	12
5. CC	ONCLUSIONS AN	D RECOMMENDATIONS	14
6. RE	FERENCES		10
7. FI	GURES		
8. PI	IOTOGRAPHS		
9. AI	PPENDICES		
	APPENDIX A	ZPA QUESTIONNAIRE	
	APPENDIX B	PH ASSOCIATES QUESTIONNAIRE	
	APPENDIX C	MINISTRY RECORDS, REVIEW AND INTERVIEWS	
	APPENDIX D	ENVIRONMENTAL REGULATIONS OF ZAMBIA	
	APPENDIX E	ENVIRONMENTAL ASSESSMENT CHECKLIST	
	APPENDIX E	FACILITY DECORDS	

CONFIDENTIALITY STATEMENT This is an internal document, prepared for the Zambia Privatization Agency (ZPA) and the United States Agency for International Development (USAID), by PH Associates, Inc. for their use. The information contained in this document is confidential and proprietary in nature, and is to be used in conjunction with other facts and data for the sole purpose of providing information concerning potential environmental liabilities.

1. INTRODUCTION

An environment assessment was conducted by PH Associates, Inc. of the Zambia Steel and Building Supplies Limited (ZSBS) Door Factory Facility, Lusaka, Zambia. The purpose of the assessment was to determine whether air, soil, surface water, or groundwater has been potentially affected at the facility site by current or past site activities or processes, and to provide information concerning potential environmental liabilities. This assessment was based on Ministry reviews and interviews, review of applicable environmental regulations, aerial photographs, facility records, interview of site personnel, and an onsite/offsite reconnaissance of the property.

This report has been prepared for the Zambia Privatization Agency (ZPA) pursuant to a contractual agreement between the U-S Agency for International Development (USAID) and PH Associates, dated March 16, 1995. The report is based on limited documented information and interviews with available facility personnel, is accurate to the best of PH Associates knowledge and belief, and has been prepared for the exclusive use of ZPA for specific application to the above-referenced facility. No warranty, expressed or implied, is made. In the event of any changes in the nature, design or locations of the facility site or structures, the conclusions and recommendations in this report should not be considered valid unless the changes are reviewed and the conclusions are verified in writing by PH Associates. This report should not be construed to be a legal representation or interpretation of environmental laws, rules, or regulations.

1.1 Background

As part of a preliminary information gathering activity in 1992, the ZPA distributed a questionnaire requesting disclosure of specific company and site information that would be relevant to completing the environmental assessment. The questionnaire for Zambia Steel and Building Supplies Limited (ZSBS) Door Factory in Lusaka was not returned to ZPA.

Additional environmental data was requested by PH Associates in the form of a questionnaire submitted to the facility during June and July 1994. The purpose of the PH Associates questionnaire was to obtain information that was either not available at the time, or to supplement information not fully detailed in the returned ZPA questionnaire. The additional data was obtained by distributing an extensive environmental survey questionnaire to facility management, and requesting their cooperation in completing and returning the survey form. The PH Associates questionnaire was not returned for the ZSBS Door Factory.

ZSBS Door Factory manufactures flush and hardwood doors, wood furniture, and coffins. According to management, the ZSBS Door Factory is currently operating at approximately 30% production capacity due to of their poor financial situation. The 200 square meter facility is located on Kapatu Road in the industrial area of Lusaka, Zambia (Section 7, Figure 1) and commenced operations in 1965. ZSBS also own a wood treatment facility (closed) on Malambo Road, and a head office and storage facility on Buyantanshi Road in Lusaka. These facilities are 400 meters east and 1.5 kilometers west respectively, of the ZSBS Door Factory. ZSBS main manufacturing facility is located on Plot 4645 Chingola Road in Kitwe, Zambia. These three ZSBS facilities were also assessed by PH Associates and will be addressed in separate reports.

Many other industries are located within a 1 kilometer radius of the ZSBS Door Factory, and include Komatsu Limited (vehicle and heavy equipment repair facility), Match Corporation Limited, Steel Fabrications Limited, National Milling Company Limited, and

PH Associates, Inc. Page 1

the United Bus Company of Zambia Limited depot. The Mulobela and Namununga residential areas are located within a 1 kilometer radius of the ZSBS Door Factory to the north and south respectively.

PH Associates, Inc.

2. SCOPE OF WORK

PH Associates performed an environmental assessment to assess and document potential adverse environmental effects on air, soil, surface water, and groundwater that might have resulted from either current or past activities on the site. This assessment was qualitative, based on readily available existing information, interviews and field observations. It did not involve environmental field testing or sampling, laboratory analyses, or an asbestos survey.

In general, PH Associates staff endeavored to:

- Conduct interviews with Ministry personnel and other pertinent organizations to assess the current state of environmental affairs and regulations.
- Review available Ministry reports on past facility inspections and geologic and hydrogeologic data.
- Evaluate existing environmental regulations that are applicable to assessing potentially adverse effects on air, soil, surface water and groundwater.
- Review available facility files to investigate past or current activities on the site with respect to
 environmental permits and compliance, wastewater, site drainage, and air emissions; and
 handling, storage, treatment, and disposal or spills of potentially hazardous materials and
 wastes.
- Review readily available aerial photographs of the site and adjacent properties. In addition, PH Associates reviewed available drawings of the site showing facility layout, underground piping, buried tanks, utilities and site drainage systems.
- With the consent of the site management, perform an onsite field reconnaissance of the facility. During the field reconnaissance, PH Associates looked for evidence of releases of potentially hazardous chemicals, petroleum products, or process wastes to the soil, surface water, and groundwater by spilling, dumping, burning or burial of materials.
- Perform a field reconnaissance of the area, within approximately 1 kilometer radius of the facility, that was feasible within the level of effort identified for this contract. During the field reconnaissance. PH Associates attempted to identify neighboring commercial and industrial sites that may potentially adversely affect the environmental conditions at the facility.
- Interview available staff who were knowledgeable of current and past site activities and processes at the facility and of surrounding properties.
- Document the findings and observations of the visited site with photographs. Copies of these photographs are included in Section 8 of this report.
- Prepare an Environmental Assessment Report presenting the areas of environmental concerns, results of the Ministry records, applicable environmental regulations, aerial photograph reviews, site visits and personnel interviews, and provide conclusions and recommendations for submission to USAID and ZPA.

METHODOLOGY 3.

This section presents the methodology used to complete the scope of work for the environmental Methods used include a review of the ministry records, environmental assessment project. regulations, aerial photographs, facility records, ministry and facility personnel interviews, and site Results of the assessment are presented in Section 4.0, and the conclusions and recommendations are presented in Section 5.0.

Ministry Records Reviews and Interviews 3.1

PH Associates interviewed Ministry personnel and other pertinent organizations to discuss the current state of environmental affairs and regulations in Zambia. Ministry records, such as factory inspections, geologic and hydrogeologic reports, were also obtained and reviewed for the sites to be assessed.

The following Ministries personnel and other pertinent organizations were interviewed and the results of these discussions are included in Appendix C.

Environmental Council of Zambia

Mr Julius Kanvembo, Director - April 13, 1995

Mrs I Mbewe, Legal Officer - April 24, 1995

Ministry of Energy and Water Development, Water Affairs

Mr Stan Chisala, Senior Engineer - April 18, 1995

Ministry of Labor and Social Security, Chief Inspector of Factories

Mr K Mapani, Chief Inspector of Factories - April 20, 1995

Mr Kakoma Chivundu, Inspector of Factories - April 28, 1995

Mr Lukwesa, Inspector of Factories - April 28, 1995

Ministry of Mines and Minerals Development, Geological Survey Department

Mr O Ng ambi, Acting Director - April 24, 1995

Mr Clement Namateba, Senior Geologist (PGR) - April 24, 1995

International Bank for Reconstruction and Development (World Bank)

Mr Gedion Nkojo, Resident Representative - April 24, 1995

Mr Julius Chileshe, Natural Resource Economist - April 24, 1995

3.2 **Environmental Regulations**

Legislative Policies, Acts, and Regulations enacted by Zambia were reviewed for their applicability to completing environmental assessments of the facilities identified by the The purpose of the review was to evaluate and summarize those guidelines pertaining to environmental issues which industries in Zambia are required to adhere. A summary of the environmental regulations for Zambia is presented in Appendix D, Table 1. Twelve regulation—vere selected for review based on their potential applicability to the Six of these regulations contained applicable environmental laws assessed sites. addressing air, soil and water pollution and include:

- Water Act of 1949
- Environmental Protection and Pollution Control Act of 1990
- Water Pollution Control Regulations of 1993
- Waste Management Regulations of 1993
- Mining (Dumps) Regulations of 1972
- Mines and Minerals Act of 1976

The applicable regulations or laws used to evaluate environmental compliance of the facilities assessed are summarized in Table 2 of Appendix D. Only recently have regulations addressing the protection of human health and the environment in any detail been enacted. Prior to the passing of the Environmental Protection and Pollution Control Act of 1990 and the establishment of the Environmental Council of Zambia, legislation mostly addressed issues of worker health and safety.

Currently, no guidelines have been implemented by the Environmental Council of Zambia defining specific materials or chemicals as hazardous. Application of the term "hazardous" is generally based on specific characteristics of a substance or constituent such as ignitability, corrosivity, reactivity, and toxicity. Depending on the concentration of the constituent in sludges, soil, surface water, or groundwater, the constituent may or may not be considered hazardous.

Since Zambia has not developed hazardous chemicals guidelines. PH Associates applied fourteen programs adopted by the United States Environmental Protection Agency (EPA) and State Governments that identify substances as either hazardous, extremely hazardous, toxic or carcinogenic. The California EPA May 1992 Chemical Cross-Index reference tabulates all the hazardous chemicals and compounds listed in these programs and was used by PH Associates to assess whether substances found during the assessments were potentially hazardous.

3.3 Aerial Photographs

On April 12, 1995 the Mapping Services Section of the Survey Department was visited by PH Associates to review any available and applicable aerial photographs of the sites to be assessed. The aerial photographs were reviewed to identify possible changes in structures, topography, site activities, processes, and waste disposal practices that could be used as additional information to the current site conditions observed during PH Associates visit.

Review of the aerial photographs from the Survey Department indicated that the photographs and any enlargements are at a scale where ground objects are much too small to provide any useful information or details of the sites. Aerial photographs were available at a scale of 1:30,000 and enlargements at a scale of 1:7,500. Based on PH Associates past experience it was determined that no applicable information would be gained from use of aerial photographs at this scale.

3.4 Facility Site Reviews

Site reviews were conducted by PH Associates and included site visits, analysis of facility records and facility personnel interviews.

Page 5

3.4.1 Site Visits

PH Associates conducted a field reconnaissance of the site focusing on identifying site activities and practices that have or may have potential environmental effects in the future. An Environmental Assessment Checklist survey form was completed during the field reconnaissance and is attached in Appendix F. The Location Map and Site Plan for the facility are attached in Section 7. Photographs of the field observations taken during the site visit are included in Section 8.

A field reconnaissance of the area within approximately 1 kilometer radius of the facility was also performed to identify neighboring industries that may potentially adversely affect the environmental conditions at the facility. The offsite reconnaissance, that was feasible for the contracted level of effort, involved interviews with facility personnel and a drive-by of the surrounding area. No offsite industries were contacted or visited by PH Associates.

3.4.2 Facility Records

Facility records and aerial photographs applicable to completing the environmental assessment were requested from the facility. Records requested included documents containing information and details on building and structure designs, underground storage tanks, process flow diagrams, process materials and wastes, waste disposal, environmental permits, monitoring programs and controls, and documentation on storage or use of potentially hazardous materials. These records, if made available to PH Associates, are attached in Appendix F.

3.4.3 Interviews

Interviews were conducted with available facility personnel, usually site managers, who could provide information on past or current site activities and processes, potentially hazardous materials use and storage, spills, accidents, utilities, fuel storage areas, maintenance practices, waste disposal, permits, monitoring programs, and laboratory analyses.

6

4. RESULTS OF ENVIRONMENTAL ASSESSMENT

The results of the environmental assessment are presented below and include the following sections: Facility Ministry Records/Site Activities and Processes Environmental Setting/Field Reconnaissance Results and Applicable Environmental Regulations.

4.1 Facility Ministry Records

Environmental data for the ZSBS Door Factory was obtained from the Chief Inspector of Factories, Ministry of Labor and Social Security. The 1989 letter is attached in Appendix F, and addresses worker health and safety issues.

4.2 Aerial Photographs

No aerial photographs of the ZSBS Door Factory were available that would provide PH Associates with information applicable to completing the environmental assessment.

4.3 Facility History and Records

On May 15, 1995, Mr J Holloway of PH Associates interviewed Mr Singh - General Manager of ZSBS Lusaka, Mr Kamuchele - ZSBS Door Factory Manager, and Mr Banda - ZSBS Door Factory Production Manager, to obtain information on ZSBS Door Factory history, processes, products, available facility records, maps, and aerial photographs. A Facility Site Plan is shown in Section 7, Figure 2. According to Mr Kamuchele, the land on which the facility is situated was undeveloped prior to building the ZSBS Door Factory in 1965.

4.4 Site Activities and Processes

ZSBS Door Factory manufactures various wood products including flush and hardwood doors, furniture, and coffins. According to Mr Kamuchele, the facility produces the following average quantities of wood products annually:

- 80,000 flush doors
- 18,000 hardwood doors and
- 18,000 coffins

Mr Kamuchele stated that furniture products are made on a contract basis and he was therefore unaware of the average quantity produced each year. Plywood and lumber used in manufacturing the flush and hardwood doors is produced and obtained from ZSBS Kitwe.

A simple production process is used at the ZSBS Door Factory. The process for all ZSBS Door Factory products begins by cutting the wood materials to the required dimensions. The wood is then assembled using wooden dowels, nails, and wood adhesive. After assembly, the wood products are sanded and then varnished and lacquered by either hand or spray application.

PH Associates, Inc. Page 7

Environmental Setting 4.5

Topography 4.5.1

The regional topography of Lusaka consists generally of flat-lying, high plateau The ZSBS Door Factory is with more hilly country to the north-northeast. located in northern Lusaka on a flat-lying area at an approximate elevation of 1,240 meters above mean sea level. The site is completely paved with concrete.

The Ngwerere and Chunga River and their tributaries are the two main surface water drainage systems for the northern Lusaka area. A tributary of the Chunga River is located approximately 2.5 kilometers west of the facility and generally flows toward the north, while the Ngwerere River flows towards the northwest and is located 1.5 kilometers from the facility. Surface water at the ZSBS Door Factory is collected in onsite stormwater collection grains that discharge into an unlined ditch along Kapatu Road in the front of the facility. The drainage ditch is part of the industrial area stormwater drainage system that eventually conveys surface water runoff in the area to the Lusaka Water and Sewage Company (LWSC) sewage ponds north of the facility. Except during periods of heavy precipitation, surface water runoff from the ZSBS Door Facility infiltrates into the subsurface before reaching the LWSC facility (Section 7, Figure 2).

4.5.2 Geology

The geology of the Lusaka area is complex and consists of highly folded bedrock of the Matero Formation and younger Lusaka Formation. The surface bedrock for northern Lusaka is predominantly Matero Formation (mostly schists and slate with some interbedded quartzite) while southern Lusaka consists of Lusaka Formation (mostly limestone). These Middle to Lower Katanga (Precambrian) units were uplifted, faulted, and eroded during several major orogenic (uplift) events, with the latest occurring approximately 460 million years ago (ZGSD, These events have formed the existing high plateau peneplain 1983). characteristic of Zambia.

The Matero Formation is more resistant to erosion than the soluble Lusaka Formation, and thus explains the more hilly terrain to the north-northeast. Varying thickness of residual soil (laterites) overly the bedrock. Generally sandy soils tend to develop on the Lusaka Formation while more clayey soil is developed on the Matero Formation. The ZSBS Door Factory is located on an unknown thickness of soil overlying the Matero Formation near the unconformable contact of the Lusaka Formation.

Hydrogeology 4.5.3

The Lusaka Formation is the most important aquifer in the area due to its high solubility that produces cavities, joints, and fissures in the bedrock, and is generally located in southern Lusaka. Based on 1950-60s borehole data from the Lusaka City Water Supply wells, the Lusaka Formation Aquifer was located at initial depths of 40 to 75 meters below the ground surface (NRGS,1963). With the increased development of Lusaka since the 1960s, the initial depth to water in the Lusaka Formation Aquifer has most likely been lowered.

Shallower water is commonly encountered in the Lusaka area between 2 and 11 meters below the ground surface (NRGS, 1963). Vertical migration of surface water is a major contributor to the shallow and deeper groundwater units. There are several reasons for the development of these shallower water units:

- Perched water tables commonly develop on the more clayey laterite soils.
- Former drainage channels that have been subsequently buried by soil deposition act as subsurface drainage ways.
- Due to the large quantity of soluble limestone, extensive subsurface drainage ways have developed within the bedrock cavities and fissures.

Based on the surface water drainage system established in the industrial area and the topography of northern Lusaka area, shallow groundwater likely flows northward towards the tributaries of the Ngwerere and Chunga Rivers. Heavy pumping from high yielding wells in the heavy industrial area may potentially cause localized groundwater movement towards the producing boreholes. According to Mr Kamuchele, no boreholes are located on the facility property. No borehole information for the surrounding industrial area was available for review by PH Associates. However, Mr Kamuchele stated that the Match Corporation Limited facility to the southeast of the ZSBS Door Factory has a borehole

4.6 Field Reconnaissance Results

On May 15, 1995, a tour of the ZSBS Door Factory facility by PH Associates was provided by Mr Kamuchele, ZSBS Door Factory Manager. During the tour, ZSBS Door Factory operations and products were discussed. Results of the field reconnaissance and interview with the ZSBS Door Factory Management are presented below.

4.6.1 Utilities

The following is a summary of the utilities that service the ZSBS Door Factory as reported by Mr Kamuchele.

4.6.1.1 Electricity

Zambia Electricity Supply Corporation Limited (ZESCO) provides electricity to the ZSBS Door Factory. According to Mr Kamuchele, no electrical transformers are located at the facility.

4.6.1.2 Water Supply

The ZSBS Door Factory water supply is obtained from the LWSC. Mr Kamuchele did not know the annual water consumption for the facility.

4.6.1.3 Sanitary Sewer

According to Mr Kamuchele, the bathroom facilities at the factory are connected to the LWSC system. No septic tanks are located on the facility.

4.6.1.4 Stormwater Control

Surface water runoff from the facility is collected in concrete lined stormwater drains that run through the center of the facility and along the northern end of the ZSBS property (Section 8, Photographs 1 and 2).

PH Associates, Inc.

The stormwater drains discharge into an unlined ditch along Kapatu Road (Section 8, Photograph 3).

4.6.2 Structures

Structures at ZSBS Door Factory are made of cement blocks, bricks, steel, concrete floors, asbestos pipe insulation and roofing sheets. Most of the facility production areas are covered by a galvanized steel awning with the exception of the warehouse and office areas. These structures and facility areas are shown on the Facility Site Plan (Section 7, Figure 2) and include:

- Coffin Production Area
- Furniture Production Area (Section 8, Photograph 1)
- Flush Door Production Area (Section 8, Photograph 4)
- Hardwood Door Production Area (Section 8, Photograph 5)
- Office Buildings (Section 8, Photograph 1)
- Warehouse
- Lacquering Area and
- Sawdust Cyclone (Section 8, Photograph 6)

4.6.3 Environmental Effects and Observations

Observations made during the field reconnaissance and any potential environmental effects are discussed in the following sections.

4.6.3.1 Chemicals, Petroleum, and Process Materials

Details of chemicals, petroleums, process materials and the average annual quantities used at ZSBS Door Factory, if known, were provided by Mr Kamuchele during the site visit. These items include:

- Lumber for production of furniture, flush and hardwood doors, and coffins
- Plywood for production of the flush doors
- Nails
- Wood adhesives (Polyvinyl: 21,600 liters/year)
- Lacquer and varnish (21,600 liters/year)
- Lacquer and varnish thinners (21,600 liters/year)

ZSBS also uses interior and exterior paint for building maintenance at the facility.

These materials are stored in the warehouse in 5 liter tins and 210 liter drums. During the site visit approximately 630 liters of wood adhesive, 420 liters of lacquer thinners, 50 liters of varnish, 50 liters of lacquer, and 35 liters of paint were stored in the warehouse (Section 8, Photographs 7 - 11).

4.6.3.2 Process Waste Streams

Liquid waste streams produced at the ZSBS Door Factory include wastewater (process and sanitary) and surface water runoff. According to Mr Kamuchele, sanitary wastes at the facility are discharged to the LWSC sewer. The only process wastewater generated at the facility originates from the lacquer spray booth in the lacquering area (Section 7, Figure 2). Water, cascading down the back of the spray booth, is used to reduce the lacquer fumes during spraying and as a result, the lacquer mixes with the water. This wastewater is discharged into a stormwater collection drain that empties into a drainage ditch along the front of the facility and infiltrates into the subsurface (Section 8, Photographs 3). Mr Kamuche did not know the average volume of wastewater discharged from the facquering area but did state that the lacquer spray booth had not been used for months. However, PH Associates observed wastewater discharge from the lacquering area in the offsite unlined drainage ditch at the stormwater drain outfall (Section 8, Photograph 3).

Surface water runoff from the ZSBS Door Factory is collected in stormwater drains that run through the ce, 'er of the process area. This wastestream potentially contains lacquer, varnish, paint and wood adhesive constituents spilled around the facility (Section 8, Photograph 2). The surface water runoff discharges into an unlined drainage ditch in front of the facility.

Solid wastes produced at the ZSBS Door Factory include sawdust, scrap wood, office trash, and empty lacquer, varnish, thinners, wood adhesive, and paint containers.

4.6.3.3 Air Emissions

Air emissions from the ZSBS Door Factory include sawdust and volatiles from lacquer, varnish, thinners, paint, and wood adhesive generated during operations at the facility. No boilers are used at the ZSBS Door Factory.

4.6.3.4 Pesticide/Herbicide Use

According to Mr Kamuchele, no pesticides or herbicides are used at the facility.

4.6.3.5 Underground/Aboveground Storage Tanks

No underground storage tanks (USTs) or aboveground storage tanks (ASTs) are located at the ZSBS Door Factory.

4.6.3.6 Releases/Spill Controls

Minor wood adhesive and varnish spills were observed in the flush door production area and the furniture production area that may possibly be washed into the stormwater collection drains at the facility (Section 8, Photograph 2). Process wastewater containing lacquer from the spray booth and surface water runoff potentially containing lacquer, varnish,

paint and wood adhesive constituents are discharged into a drainage ditch along the front of the facility (Section 8, Photographs 3).

4.6.3.7 Potentially Hazardous Materials

Currently, no guidelines have been implemented by the Environmental Council of Zambia defining specific materials or chemicals as hazardous. Application of the term "hazardous" is generally based on specific characteristics of a substance or constituent such as ignitability, corrosivity, reactivity, and toxicity. Depending on the concentration of the constituent in sludges, soil, surface water, or groundwater, the constituent may or may not be considered hazardous.

Materials onsite such as the lacquer, varnish, wood adhesives, paint, and the process wastewater and surface water runoff may potentially contain specific organic and inorganic constituents at levels that could be identified as hazardous and regulated once guidelines are enacted. Applying regulations adopted by the EPA, these constituents potentially pose a threat to human health and the environment based on ignitability, toxicity, and human carcinogenic risk (Cal EPA, 1992).

A sbestos found in the sheet roofing and pipe insulation at the facility is also nazardous and known to produce lung cencer in individuals who have had prolonged exposure.

4.6.3.8 Waste Disposal

Liquid wastes produced at the ZSBS Door Factory include wastewater (process and sanitary), and surface water runoff. The sanitary wastewater is discharged to the LWSC sewer. Process wastewater and surface water runoff from the facility potentially contain lacquer, varnish, thinners, paint, and wood adhesives, and are discharged into the drainage ditch along the front of the facility. These wastewaters infiltrate into the subsurface potentially adversely affecting subsurface soil and groundwater quality in the area. No disposal volumes were available from ZSBS Door Factory.

Sawdust waste generated at the facility is sold to local poultry farmers. According to Mr Kamuchele, empty material containers and drums are returned to the manufacturers and refilled. Scrap wood and office trash is collected by the LWSC and disposed of offsite.

4.7 Applicable Environmental Regulations

A summary of the applicable regulations for Zambia is presented in Table 2 of Appendix D. Based on a review of these regulations, the ZSBS Door Factory is:

• illegally discharging without a discharge license, wastewater that potentially contains lacquer, varnish, thinners, raint, and wood adhesive constituents.

The Environmental Protection and Pollution Control Act of 1990, states that no person may discharge (directly or indirectly) poisonous, toxic, obnoxious or obstructing matter, or other pollutants into surface or groundwater bodies. Surface water runoff potentially containing spilled process materials and wastewater from the lacquering area is illegally

12

discharged from the facility without a license. These discharges may potentially adversely impact soil and groundwater quality in the area.

The Water Pollution Control (Effluent and Wastewater) Regulations of 1993, require a license to discharge wastewater that may pollute the environment (this includes discharges to the Council sewer). The conditions of the license include discharge record keeping. weekly sampling and testing of the wastewater, and submission of a bi-annual report to the ECZ. The discharger must meet the standards (limits) for parameters listed in Table 3 of Appendix D.

According to Mr Kamuchele, no discharge licenses or permits have been obtained by the ZSBS Door Factory.

5. CONCLUSIONS AND RECOMMENDATIONS

The following conclusions and recommendations are presented addressing areas of environmental concerns at the Zambia Steel and Building Supplies Limited, Door Factory facility, based on the findings of the environmental assessment.

- Wastewater containing lacquer has been discharged from the stormwater collection drains into the unlined drainage ditch in front of the facility. As a result, subsurface soil and groundwater quality may potentially have been adversely affected in the area.
- Wood adhesive and varnish have been spilled in the flush door production area and the furniture production area. If these spills are washed into the stormwater collection drains and discharged into the offsite drainage ditch in front of the facility, subsurface soil and groundwater quality in the area may potentially be adversely affected.
- Surface water runoff potentially containing spilled process materials and wastewater from the lacquering area is illegally discharged from the facility without a license. These discharges may potentially adversely impact soil and groundwater quality in the area.
- Surface water runoff potentially containing spilled process materials and wastewater from the lacquering area is illegally discharged from the facility without a license. These discharges may potentially adversely impact soil and groundwater quality in the area.
- Asbestos is used at the facility in pipe insulation and in the roofing sheets. Asbestos is a known lauman carcinogenic.
- No USTs or ASTs are located at the ZSBS Door Factory.
- No boreholes are located on the ZSBS property.
- No transformers are used at the facility.
- Air emissions of sawdust and volatiles from lacquer, varnish, thinners, paint, and wood adhesive are released from the ZSBS Door Factory. Based on the quantities of process materials used no significant adverse environmental effects are expected from air emissions at the facility.
- ZSBS Door Factory lacks any environmental safety and procedures plan detailing storage, handling, cleanup, and disposal procedures for the facility.
- Based on the field reconnaissance of the area surrounding the facility, there are several neighboring industries (Komatsu Limited, Match Corporation Limited, Steel Fabrications Limited, National Milling Company Limited, and the United Bus Company of Zambia depot) that may also be expected to potentially adversely affect the environmental conditions of the surrounding area.

PH Associates recommends that

- ZSBS Door Factory mitigate potential adverse effects to offsite soil and groundwater quality by removing wood adhesive and varnish spills that might be washed into the stormwater collection drains. The drains in these areas should be connected to the LWSC sewer to mitigate further offsite discharge of the impacted surface water runoff.
- ZSBS Door Factory stop discharging wastewater containing lacquer from the lacquering area into the offsite drainage ditch. This wastewater should be discharged to the LWSC sewer after a discharge permit has been obtained.
- ZSBS Door Factory investigate soil and groundwater quality offsite in the area of the drainage ditch where potentially polluting wastewaters from the facility have been discharged. This

PH Associates, Inc.

investigation should include collecting soil and groundwater samples to assess the level of possible adverse effects.

- ZSBS Door Factory obtain a license to discharge process and sanitary wastewater to the LWSC sewer and comply with all discharge requirements.
- ZSBS Door Factory conduct an asbestos survey and implement an asbestos removal plan at the facility.
- ZSBS Door Factory develop and implement an environmental safety and procedures plan detailing storage, handling, monitoring, cleanup, and disposal procedures for the facility to minimize potential adverse effects to the environment in the future.
- ZSBS Door Factory maintain inventory and waste disposal records specifically listing the types and quantities of chemicals, fuels, oils, and materials brought onsite and the types and quantities of materials recycled or disposed of and their disposal locations. This "cradle-to-grave" tracking of materials should be incorporated into the environmental safety and procedures program.

6. REFERENCES

BANDA

Zambia Steel and Building Supplies Door Factory, Production Supervisor, Personal Interview, May 15, 1995

CALIFORNIA ENVIRONMENTAL PROTECTION AGENCY

Chemical Cross-Index, May 1992

GOVERNMENT OF ZAMBIA

The Environmental Protection and Pollution Control Act, No 12 of 1990

GOVERNMENT OF ZAMBIA

The Mines and Minerals Act, 1976, Chapter 329 of the Laws of Zambia

GOVERNMENT OF ZAMBIA

The Mining (Dumps) Regulations, 1972, Chapter 329 of the Laws of Zambia, Section 132

GOVERNMENT OF ZAMBIA

The Waste Management (Licensing of Transporters of Waste and Waste Disposal Sites) Regulations, 1993 - Statutory Instrument No 71 of 1993, The Environmental Protection and Pollution Control Act No 12 of 1990

GOVERNMENT OF ZAMBIA

The Water Pollution Control (Effluent and Wastewater) Regulations, 1993 - Statutory Instrument No 72 of 1993. The Environmental Protection and Pollution Control Act No 12 of 1990

KAMUCHELE

Zambia Steel and Building Supplies Door Factory, Door Factory Manager, Personal Interview, May 15, 1995

NORTHERN RHODESIA GEOLOGICAL SURVEY (NRGS, 1963)

The Geology and Groundwater Resources of the Lusaka Area, Report No 16 of 1963, J G Simpson, A R Drysdall, and H H J Lambert

REPUBLIC OF ZAMBIA

The Water Act, 1949, Chapter 312 of the Laws of Zambia

PH Associates, Inc.

Page 16

REPUBLIC OF ZAMBIA

Geologic Map of the Southeast Quadrant, 1981, Scale 1:1,000,000

REPUBLIC OF ZAMBIA

Topographic Sheet 1528 C1, 1993, Scale 1:50,000

REPUBLIC OF ZAMBIA

Topographic Sheet 1528 C3, 1986, Scale 1:50,000

SINGH

Zambia Steel and Building Supplies Lusaka, General Manager, Personal Interview, May 15, 1995

ZAMBIA GEOLOGIC SURVEY DEPARTMENT

Sheet No SD-35-15, Geologic Map of the Lusaka Area, 1983, Scale 1:250,000, J G Thieme

PH Associates, Inc.

7. FIGURES


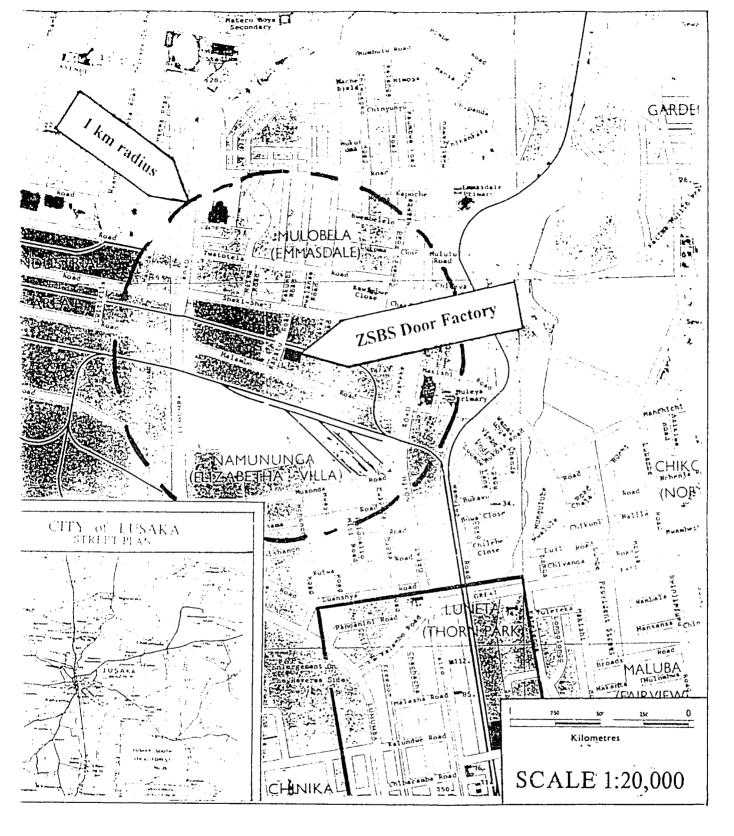




Figure 1
Site Location Map
ZSBS Door Factory
Kapatu Road
Lusaka, Zambia




8. PHOTOGRAPHS

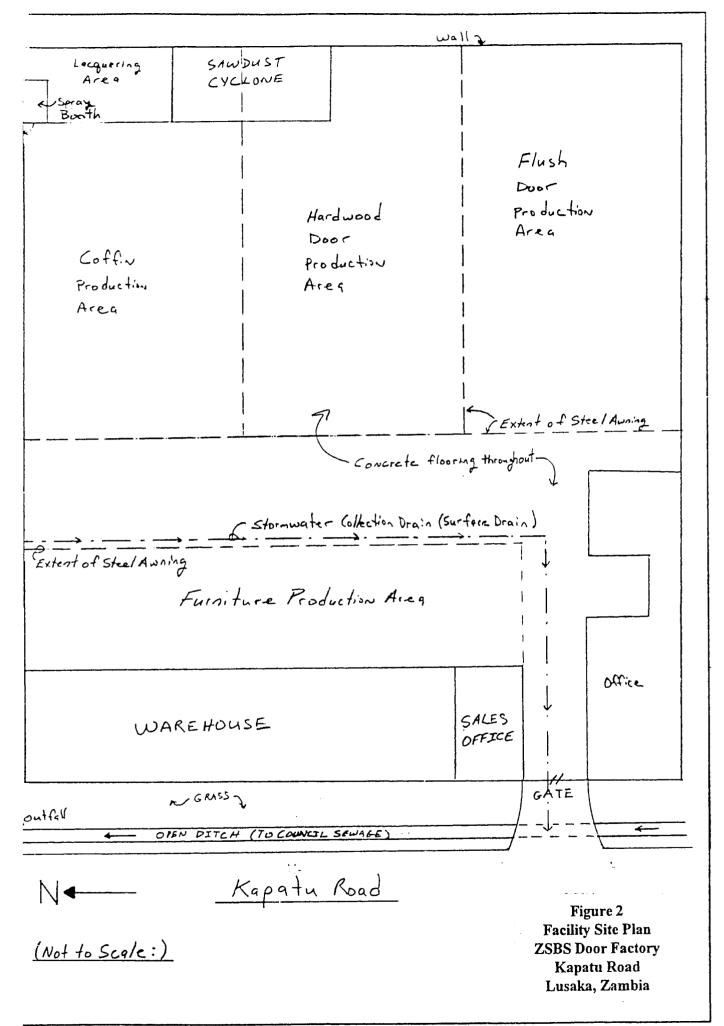


Photograph i

OFFICE AND FURNITURE PRODUCTION AREA WITH STORMWATER COLLECTION DRAIN

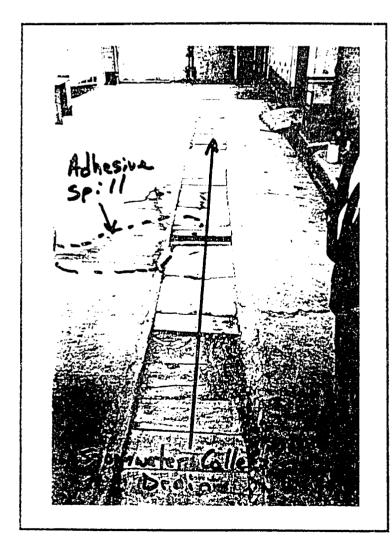


Photograph 2

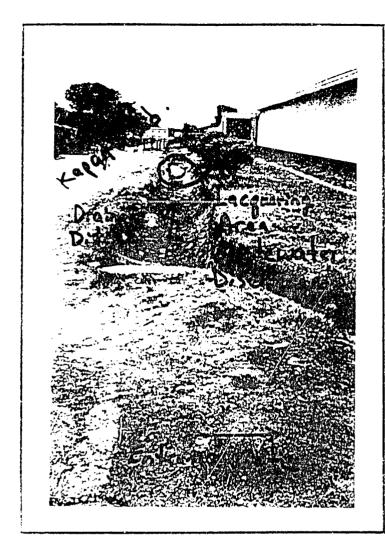

 $Photograph \ 3$


OFFSHE DRAINAGE DIFCHWITH WASHIWATER DISCHARGE FROM LACOUERING ARLY

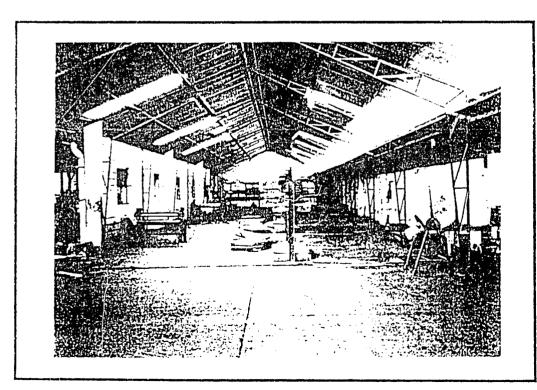

Photograph 4





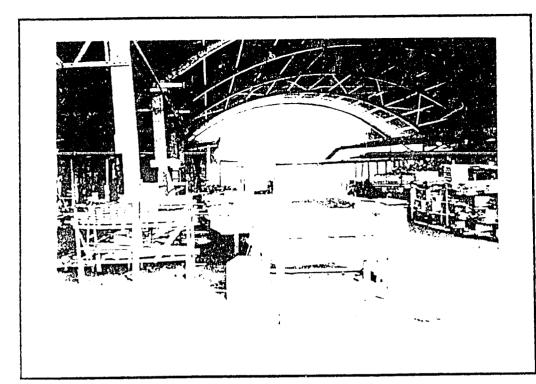

Photograph 5


HARDWOOD DOOR PRODUCTION AREA



Photograph 6

SAWDUST CACTONI

24

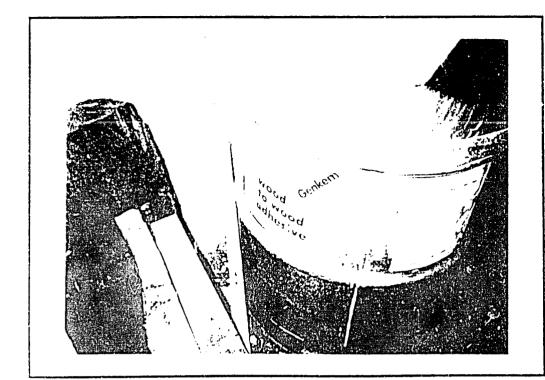

Photograph 7


WOOD ADMISSIVE STORAGE IN WAREHOUSE



Photograph 8


WOOD ADHESIVE STORAGE IN WARRHOUSE



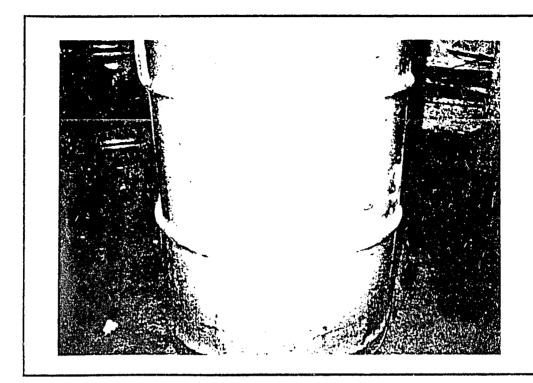


Photograph 9

LACQUER THINNERS IN WARLHOUSE

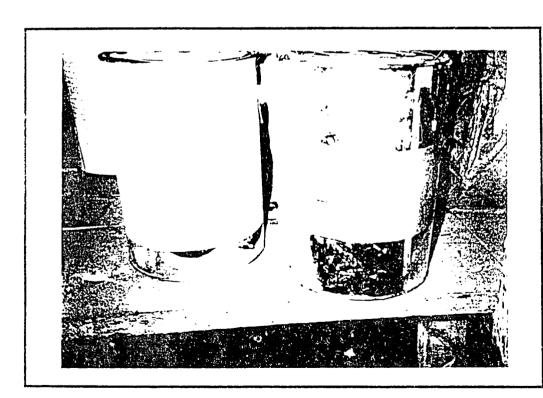

Photograph 10

ADHESIVE AND VARNISH STORAGE IN WAREHOUSE

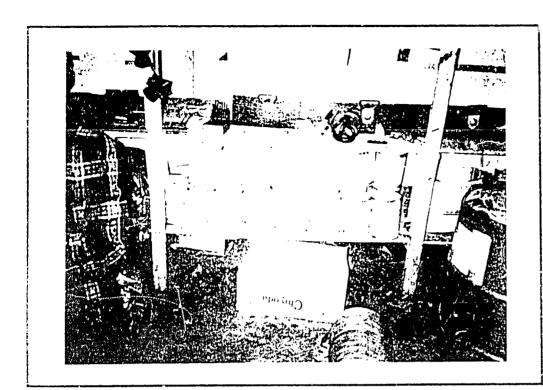

Photograph 11

PAINT AND WOOD ADMESTAL STORAGE IN WAREHOUSE

9. APPENDICES

Appendix A ZPA QUESTIONNAIRE

NO ZPA QUESTIONNAIRE WAS RETURNED FOR THIS FACILITY

Appendix B PH ASSOCIATES QUESTIONNAIRE

NO PH ASSOCIATES QUESTIONNAIRE WAS RETURNED FOR THIS FACILITY

Appendix C MINISTRY REVIEWS AND INTERVIEWS

APPENDIX C Environmental Assessment

MINISTRY REVIEWS AND INTERVIEWS

PH Associates interviewed Ministry personnel and other pertinent organizations to discuss the current state of environmental affairs and regulations in Zambia. Ministry records pertaining to assessed sites were requested, however, minimal data was acquired because many of the environmental Ministries are either relatively new and have limited records or there is a lack of funding for the environmental programs and inspections. A more detailed discussion of the environmental regulations for Zambia are presented in Appendix D and a summary of interviews are discussed below.

ENVIRONMENTAL COUNCIL OF ZAMBIA

Mr Julius Kanyembo - Director Mrs I Mbewe - Legal Officer

On April 13, 1995, Ms Elena Pomar/PH Associates visited Mr Julius Kanyembo, Director of the Environmental Council of Zambia (ECZ). Information on the enforcement of the regulations was obtained on April 24, 1995 from Mrs Mbewe, Legal Officer for the Environmental Council of The ECZ was started in 1990 to develop and implement regulations under the Zambia. Environmental Protection and Pollution Control Act, but it was not functionally operating until June 1992. Legislation and regulations on water pollution control, waste management, environmental impact assessments were recently enacted in 1993 and 1994 and are currently in the process of enforcement. Inspection and site assessments have been conducted in very limited, selected eases. No enforcement activities have been conducted for the Pesticides and Toxic Substances Regulations. Regulatory policy and resolutions are currently being drafted on air pollution and wetlands management. The Environmental Council has set the following regulations in place under the Environmental Protection and Pollution Control Act of 1990:

The Water Pollution Regulations, 1993

These regulations determine the type and amount of effluent that can be discharged from a site and permit requirements.

The Waste Management Regulations, 1993

Requires licensing for transporters of solid and hazardous waste and for operators of waste disposal facilities.

Environmental Impact Assessment Regulations, 1994

These regulations require an environmental evaluation and licensing for new project developments, repairs, and expansion to existing projects.

The Pesticides and Toxic Substances Regulations, 1994

Requires registration with ECZ if manufacturing or importing/exporting a new pesticide or toxic substance.

The ECZ has very limited documentation on contaminated sites or industrial discharges since the Council was only established in 1990.

Page 1 PH Associates, Inc.

Environmental Assessment APPENDIX C

MINISTRY OF ENERGY AND WATER DEVELOPMENT

Mr Stan Chisala - Senior Engineer Water Affairs

On April 18, 1995, Ms Pomar visited Mr Stan Chisala, Senior Engineer of the Water Affairs Department (WA), in the Ministry of Energy and Water Development. The WA was established by the Water Act of 1949, which provides for the control, ownership, and use of water. Mr Chisala stated that the Ministry does not keep any environmental pollution records for any industry in Zambia.

PH Associates was provided with a copy of the November 1994 National Water Policy issued by the Ministry of Energy and Water Development. This document serves as a guide to conservation management, demand, and supply of water resources in the country. The National Water Policy, however, has no specific policy regarding contamination or water quality control by major industries, including the Council water supply.

The Water Supplies and Water Resources Management Division of WA is expected to have a program in place within a year to monitor the quantity and quality of groundwater boreholes. Enforcement of this program will be made by the Environmental Council of Zambia. Water Affairs also hopes to have the funding to do more adequate monitoring of boreholes for bacteriological analysis in the future. They currently have a chemist to conduct sampling and analysis but these activities have not been performed due to lack of funding.

Mr Chisala discussed some of WA's concerns about industrial and domestic wastewater discharges into some of the major surface water bodies of Zambia. Industries such as textile mills, tanneries, fertilizer producers, breweries and domestic sewage are of great concern in the potential contamination of rivers. Solid waste was also pointed out to be a potential contamination problem in Zambia since most of the municipal councils do not have designated areas for the disposal of these wastes. Wastewater drainage was discussed as being inadequate since the problem of stagnation is present throughout the industrial and urban areas of the country.

MINISTRY OF LABOR AND SOCIAL SECURITY

Mr K Mapani - Chief Inspector of Factories Mr Kakoma Chivundu - Inspector of Factories Mr Lukwesa - Inspector of Factories

Mr K Mapani, Chief Inspector of Factories for the Ministry of Labor and Social Security, was interviewed on April 20, 1995, by Ms Pomar to request available information on the sites where environmental assessments are to be conducted by PH Associates. There is approximately 10 years of available data for facility site inspections at the Ministry of Labor and Social Security. Mr Mapani stated that his office is basically concerned with inspections of factory sites where accidents or complaints have been filed.

The Chief Inspector of Factories currently has approximately 364 factory/industrial sites entered into a database, and a series of old reports. A database template was prepared for each site and includes a workplace number, industry classification and various parameters on Worker Health and Safety. The database was found to be poorly maintained and apparently the best information is found in the original site inspection reports. According to Mr Mapani, the department is currently understaffed by about 50%, thus regular visits to all facilities are difficult to perform.

PH Associates, Inc.

Environmental Assessment APPENDIX C

On April 28, 1995, Ms Pomar met with Mr Kakoma Chivundu and Mr Lukwesa, both Factory Inspectors. PH Associates were provided with site inspection reports for several sites where environmental assessments will be performed. These are summarized in the individual reports, where applicable. Typical problems that are encountered during their site inspections include old and outdated machinery that can cause accidents, lack of maintained fire extinguishers, and noise and air quality problems.

MINISTRY OF MINES AND MINERALS DEVELOPMENT

Mr O Mg'ambi - Acting Director of Geological Survey Department Mr Clement Namateba - Senior Geologist (PGR), Geological Survey

PH Associates met with Mr O Mg'ambi, Acting Director and Mr Clement Namateba, Senior Geologist of the Geological Survey Department to discuss the regional geologic and hydrogeologic setting of Zambia. A listing of available geologic and hydrogeologic reports and maps were provided by the Department, and those covering the sites to be assessed were purchased.

INTERNATIONAL BANK FOR RECONSTRUCTION AND DEVELOPMENT

Mr Gedion Nkojo - Resident Representative, World Bank Mr Julius Chileshe - National Resource Economist, World Bank

On April 24, 1995, Ms Pomar met with Mr Gedion Nkojo, Resident Representative and Mr Julius Chileshe, Natural Resource Economist of the World Bank to request any information regarding historical data for the sites where environmental assessments are to be conducted. Mr Nkojo and Mr Chileshe stated that there was no specific environmental information for the sites.

The importance of having a unified and more focused plan for addressing environmental concerns in the country on behalf of the Government of Zambia (GOZ), NGOs (Non-Government Organizations), International Development Organizations (such as World Bank, UNDP, Africar Development Bank, etc), and other donor countries, was discussed at great length. The World Bank is presently working on an Environmental Support Program to be included in the National Environmental Action Place for the Secretariat of the Ministry of Environment and Natural Resources.

Page 3

Appendix D ENVIRONMENTAL REGULATIONS OF ZAMBIA

ENVIRONMENTAL REGULATIONS OF ZAMBIA

As part of the PH Associates scope of work, legislative Policies, Acts, and Regulations enacted by Zambia were reviewed for their applicability to completing environmental assessments of the enterprises identified by the ZPA for privatisation. The purpose of the review was to evaluate and summarize those guidelines pertaining to environmental issues which industries in Zambia are required to adhere. The industries to be assessed include food, agricultural and livestock farmlands, pharmaceutical drug, textile, sawmilling, storage and transportation, construction and engineering, mining and petroleum.

Regulations addressing the protection of human health and the environment have only recently been enacted in any detail. Prior to the passing of the Environmental Protection and Pollution Control Act of 1990 and the establishment of the Environmental Council of Zambia, legislation mostly addressed issues of worker health and safety.

Twelve regulations were selected for review based on their potential applicability to the assessed sites, and are listed in Table 1. Six of these regulations address environmental issues concerning air, soil, and water pollution and include:

- Water Act of 1949
- Environmental Protection and Pollution Control Act of 1990
- Water Pollution Control Regulation of 1993
- Waste Management Regulations of 1993
- Mining (Dumps) Regulations of 1972
- Mines and Minerals Act of 1976

These regulations are summarized in Table 2 and used to evaluate the environmental compliance of the facilities assessed by PH Associates. Of the six regulations listed above, the first four comprise the majority of established environmental legislation and are applicable to most of the assessed industries.

P II Associates, Inc. 2 4 Page 1

TABLE 1 ENVIRONMENTAL REGULATIONS AND ENFORCING MINISTRIES OF ZAMBIA

ENFORCING MINISTRIES OF ZAMBIA				
Policy, Act, or Regulation	Year Adopted	Responsible Ministry		
Water Act	1949	Ministry of Energy and Water Development (Water Board)		
National Water Policy	1994	Ministry of Energy and Water Development		
Environmental Protection and Pollution Control Act	1990	Environmental Council of Zambia		
Water Pollution Control (Effluent and Wastewater) Regulations	1993	Environmental Council of Zambia		
Waste Management (licensing of Transporters of Wastes and Waste Disposal Sites) Regulations	1993	Environmental Council of Zambia		
Pesticides and Toxic Substances Regulations	1994	Environmental Council of Zambia		
Environmental Impact Assessment Regulations	1994	Environmental Council of Zambia		
Petroleum Act	1930	Ministry of Energy and Water Development (Department of Energy)		
Petroleum (Exploration and Production) Act	1985	Ministry of Energy and Water Development (Department of Energy)		
Agricultural (Fertilizers and Feed) Act	1990	Ministry of Agriculture		
Mining (Dumps) Regulations	1972	Ministry of Mines and Minerals Development		
Mines and Minerals Act	1976	Ministry of Mines and Minerals Development		

TABLE 2				
APPLICABLE ENVIRONMENTAL REGULATIONS				
OF ZAMBIA				
ACT OR REGULATION	APPLICABLE REGULATIONS			
The Water Act 1949	 Any person(s) shall have the right to the primary use of public water which is found in its natural channel where access is lawful. A person(s) must have permission from the Water Board (WB) to impound, store, or divert water from a public stream for primary (drinking), secondary (irrigation), or tertiary (mechanical or industrial) use. Any land owner must have permission from WB for use of private water supply. Local authorities must get permission from WB to use public water for primary or tertiary use. Any person(s) who willfully or through negligence pollutes or fouls any public water so as to render it harmful to man, beast, fish, or vegetation, shall be guilty of an offense. 			
The Environmental Protection and Pollution Control Act 1990	 water Regulations No person may discharge (directly or indirectly), poisonous, toxic, obnoxious or obstructing matter, radiation or other pollutants into surface or groundwater bodies. Industrial/trade owners or operations that discharge effluent from the facility into existing sewage system must obtain written permission from the local authority. Local authority sewage systems may impose special conditions (ie pretreatment) to facilities that discharge effluent into their system. Effluent may be mixed for treatment prior to discharge or for conveyance to common point of discharge. No local authority sewage system or industry/trade shall discharge (directly or indirectly) effluent into surface water or groundwater environment without a license. Any changes to the type, quantity of pollutant, or discharge location must be authorized by the Inspectorate. Waste Regulations No person(s) shall discharge waste so as to cause pollution in the environment. Based on the interpretation of this regulation by the ECZ, it is illegal to dump or bury waste anywhere but at a licensed disposal facility (no backyard dumping). No person(s) shall transport waste to any site other than a licensed disposal facility. Any person(s) intending to operate a waste disposal plant or generate hazardous waste must have a license. No hazardous waste shall be exported to any country without a Council (ECZ) permit and consent of receiving country. No hazardous waste shall be transported within or through Zambia 			

ACT OR REGULATION	APPLICABLE REGULATIONS
Water Pollution Control Regulations of 1993	 All commercial, municipal, and industrial facilities must possess a license to discharge wastewater that may pollute the environment. Keep facility records of the licensed activities. Conduct weekly sampling and testing of discharged wastewater at locations designated by ECZ Inspectorate. The quality of wastewater discharged must meet the conditions and standards for all parameters contained in Table 3. If any wastewater test results exceed these standards, they must be reported to the Inspectorate within 12 hours. Monitor the volume of wastewater discharged from the site using a metering device. Submit bi-annual reports to the ECZ Inspectorate including the mean monthly test analyses results and mean monthly volume of wastewater being discharged. License to Withdraw Water Facilities must posses a license to withdraw water from a watercourse for the purpose of diluting effluent. The source of water being withdrawn would not significantly affect the water course. The license holder must treat effluent so there are no adverse effects to the surface and groundwater environment. The license holder must keep a record of licensed activities and provide a report to ECZ Inspectorate every six months. The license holder must conform to all the following wastewater discharge regulations.
Waste Management Regulations 1993 The Mining	 All commercial, municipal, or industrial facilities must posses a license to transport solid wastes offsite. During loading and transport, wastes cannot be scattered, flowing out, or emitting bad smells. Vehicles must transport wastes along approved, scheduled routes. Transporter license may be valid from 6 months to 3 years depending on the transporters compliance with these regulations. Supervise/inspect site for the prevention of pollution of the
Regulations 1972	surroundings or abatement of any nuisance.
The Mines and Minerals Act 1976	 Avoidance of wasteful mining practices or wasteful metallurgic practices. Any effluent water discharged from any treatment or other process at a mine must comply with the provisions of the Water Act.

Page 4 P H Associates, Inc.

Environmental Assessment
APPENDIX D

THE WATER ACT Chapter 312, Adopted 1949, Amendments up to 1970

The Water Act provided the initial guidance for the control, ownership, and use of water in Zambia. This Act established the Water Board (WB) in the Ministry of Energy and Water Development.

The purpose of the Water Boal Lis to supervise all public streams in Zambia, protect the source of water streams, maintain and is prove streams, and help prevent unlawful acts (polluting) of streams. The Act does not apply to the Zambezi, Luapula, and part of the Luangwa River.

Applicable Regulations

The Act provides for some basic laws on water rights, some of the regulations that may apply to the assessed sites include:

- Any person(s) shall have the right to the primary use of public water which is found in its natural channel where access is lawful.
- A person(s) must have permission from the WB to impound, store, or divert water from a public stream for primary (drinking), secondary (irrigation), or tertiary (mechanical or industrial) use.
- Any land owner must have permission from WB for use of private water supply.
- Local authorities must get permission from WB to use public water for primary or tertiary use.
- Any person(s) who willfully or through negligence pollutes or fouls any public water so as to render it harmful to man, beast, fish, or vegetation, shall be guilty of an offense.

42

APPENDIX D

NATIONAL WATER POLICY OF 1994

This policy discusses planning, implementation strategies, management, and development of water resources for Zambia, and was issued as an internal guidance document under the National Water Policy Development Initiative (Water Development Board) by the Ministry of Energy and Water Development. The Water Development Board proposes and amends existing legislation and enacts new legislation.

Applicable Regulations

None. The policy does not provide any water regulations.

Page 6

THE ENVIRONMENTAL PROTECTION AND POLLUTION CONTROL ACT Act No 12, Adopted 1990

This Act provides for the protection of the environment, the control of pollution, and the establishment of the Environmental Council of Zambia (ECZ). The ECZ consists of representatives from 25 different ministries, and formulates policies relating to environmental management of natural resources and the control of industrial and other sources of pollution. The Council reviews environmental government reports, conducts studies and promotes research, educates the public about environmental issues, and conducts other relevant tasks.

The Act includes regulations for water, air, waste, pesticides and toxic substances, noise, ionizing radiation, and natural resource conservation. Many of these regulations are the basis for the updated Water Pollution Control Regulations (1993), Waste Management Regulations (1993), Pesticides and Toxic Substances Regulations (1994), and Environmental Impact Assessment Regulations (1994).

This Act and the ECZ were initiated in 1990, although the Council was not fully operational until June 1992 (Appendix C). Since the ECZ is still a relatively new institution, air, hazardous and toxic waste, and noise standards have not been established.

Applicable Regulations

The Act provides generalized regulations that are applicable to discharge of solid waste and wastewater pollutants into the environment.

Water Regulations

- No person may discharge (directly or indirectly), poisonous, toxic, obnoxious or obstructing matter, radiation or other pollutants into surface or groundwater bodies.
- Industrial/trade owners or operations that discharge effluent from the facility into existing sewage systems must obtain written permission from the local authority.
- Local authority sewage systems may impose special conditions (ie pretreatment) to facilities that discharge effluent into their system.
- Effluent may be mixed for treatment prior to discharge or for conveyance to common point of discharge.
- No local authority sewage system or industry/trade shall discharge (directly or indirectly) effluent into surface water or groundwater environment without a license. Any changes to the type, quantity of pollutant, or discharge location must be authorized by the Inspectorate.

P H Associates, Inc.

Page 7

Environmental Assessment APPENDIX D

Air Regulations

Based on discussions with the ECZ (Appendix C), legislation and standards on air pollution are currently being drafted. A review of the air pollution section of this Act shows the following areas will be addressed:

- No person(s) will be allowed to emit any pollutants above emission standards (to be developed).
- Polluting facilities will be required to have licenses, conduct period air sampling and testing, and provide reports to the Inspectorate.

Until these regulations are completed and adopted, there are no applicable air emission requirements for Zambia.

Waste Regulations

Waste handling regulations are found in more detail in the Waste Management Regulations (1993).

- No person(s) shall discharge waste so as to cause pollution in the environment. Based on the interpretation of this regulation by the ECZ, (personal communication with Michael Sankwe/ECZ), it is illegal to dump or bury waste anywhere but at a licensed disposal facility (no backyard dumping).
- No person(s) shall transport waste to any site other than a licensed disposal facility.
- Any person(s) intending to operate a waste disposal plant or generate hazardous waste must have a license.
- No person(s) shall import any hazardous waste into Zambia.
- No hazardous waste shall be exported to any country without a Council (ECZ) permit and consent of receiving country.
- No hazardous waste shall be transported within or through Zambia without a Council permit.

Pesticides and Toxic Substances Regulations

Many of the regulations regarding pesticides and toxic substances relate to the manufacture, import or process of a "new" pesticide or toxic substance. Currently, there are no guidelines or standards defining specific materials or chemicals as toxic or hazardous.

Noise Regulations

No noise regulations are specified in the Act because the ECZ has yet to establish noise emission standards and guidelines.

PH Associates, Inc.
Page 8

APPENDIX D Environmental Assessment

THE WATER POLLUTION CONTROL (EFFLUENT AND WASTEWATER) REGULATIONS OF 1993

These regulations are part of the Environmental Protection and Pollution Control Act of 1990. The regulations require that any local authority intending to operate a sewage treatment system or owner/operator of any industry that discharges wastewater (directly or indirectly) into any surface water or groundwater environment must apply for a license through the Environmental Council of Zambia (ECZ). Person(s) must also have a license from ECZ to withdraw water from a watercourse for the purpose of diluting effluent.

ECZ has developed standards (limits) for 59 physical, bacteriological, chemical, organic, metal, and radioactive parameters. These parameters and standards are listed in Table 3. wastewater may NOT exceed these parameter standards.

Applicable Regulations

These wastewater discharge regulations are applicable to many of the sites to be assessed. The following conditions of the licenses are most noteworthy, refer to the original regulation for more specific details.

License to Discharge Wastewater

- All commercial, municipal, and industrial facilities must possess a license to discharge wastewater that may pollute the environment.
- Keep facility records of the licensed activities.
- Conduct weekly sampling and testing of discharged wastewater at locations designated by ECZ Inspectorate.
- The quality of wastewater discharged must meet the conditions and standards for all parameters contained in Table 3. Any wastewater test results which exceed these standards, must be reported to the Inspectorate within 12 hours.
- Monitor the volume of wastewater discharged from the site using a metering device.
- Submit bi-annual reports to the ECZ Inspectorate including the mean monthly test analyses results and mean monthly volume of wastewater being discharged.

License to Withdraw Water

- Facilities must posses a license to withdraw water from a watercourse for the purpose of diluting effluent.
- The source of water being withdrawn would not significantly affect the water course.
- The license holder must treat effluent so there are no adverse effects to the surface and groundwater environment.

Page 9 PH Associates, Inc.

Environmental Assessment APPENDIX D

 The license holder must keep a record of licensed activities and provide a report to ECZ Inspectorate every six months.

The license holder must conform to all the wastewater discharge regulations.

TABLE 3 WATER POLLUTION CONTROL REGULATIONS STANDARDS (LIMITS) FOR EFFLUENTS AND WASTEWATER

STANDARDS (LIMITS) FOR EFFLUENTS AND WASTEWATER			
Parameter	Standards (Unit)		
Temperature	40° C		
Color	20 (Hazen units)		
Color Odor and Taste	Threshold odor number		
	15 NTU		
Turbidity	100 mg/L		
Total Suspended Solids	0.5 mg/L		
Settleable Matter	3000 mg/L		
Total Dissolved Solids	4300 US/cm		
Conductivity	1500 00.000		
	25000/100 ml		
Total Coliform	5000/100 ml		
Fecal Coliform	1000 cells/100 ml		
Algae	1000 66113/100 1111		
	6.0 - 9.0		
pH	5 mg/L		
Dissolved Oxygen	90 mg (average)		
Chemical Oxygen Demand	50 mg/L (Mean Value)		
Biochemical Oxygen Demand (BOD)	20 mg/L lakes		
Nitrates	50 mg/L (watercourse)		
	1		
Nitrite (NO2 as nitrogen)	2.0 mg/L		
Organic Nitrogen	5.0 mg/L (Mean)		
Total Ammonia and Ammonium (NH3)	10 mg/L		
Cyanides	0.2 mg/L		
	1.0 mg/L		
Total Phosphorous (PO4)	1500 mg/L		
Sulfates	1.0 mg/L		
Sulfite	_		
Sulfide	0.1 mg/L		
Chlorides	8000 mg/L		
Active Chloride	0.5 mg/L		
Active Bromine (Br2)	0.1 mg/L		
Fluorides	2.0 mg/L		
	2.5 - 7		
Aluminium	2.5 mg/L		
Antimony	0.5 mg/L		
Arsenic	0.05 mg/L		
Barium	0.5 mg/L		
Beryllium salts	0.5 mg/L		
Boron	0.5 mg/L		
Cadmium	0.5 mg/L		
Total Chromium	0.1 mg/L		
Cobalt	1.0 mg/L		
	1.5 mg/L		
Copper	2.0 mg/L		
Iron			

Parameter	Standards (Unit)		
Lead	0.5 mg/L		
Magnesium	500 mg/L		
Manganese	1.0 mg/L		
Mercury	0.002 mg/L		
Molybdenum	5.0 mg/L		
Nickel	0.5 mg/L		
Selenium	0.02 mg/L		
Silver	0.1 mg/L		
Thallium	0.5 mg/L		
Tin	2.0 mg/L		
Vanadium	1.0 mg/L		
Zinc	10.0 mg/L		
Total hydrocarbons	10.0 mg/L		
Oils (Mineral and Crude)	5.0 mg/L		
Phenols	0.2 mg/L (steam dist)		
T henois	0.05 mg/L (non-steam dist)		
Fats and saponifiable oils	20.0 mg/L		
Detergents	2.0 mg/L		
Total Pesticides and PCB's	0.5 mg/L		
Trihaloforms	0.5 mg/L		
Radioactive materials	Not permitted		

NOTE

See original Water Pollution Control Regulations and third schedule for standard and test method details.

WASTE MANAGEMENT (LICENSING OF TRANSPORTERS OF WASTES AND WASTE DISPOSAL SITES) **REGULATIONS OF 1993**

These regulations are part of the Environmental Protection and Pollution Control Act of 1990. The regulations only address the handling of "solid waste" generated by commercial, municipal, and industrial sites (personal communication, Michael Sankwe/ECZ). The regulations do not apply to hazardous or toxic substances, generated at commercial, municipal, industrial or household sites. They also do not apply to residential domestic solid wastes of less than 45 kg (99 pounds) per week, or to the transport of inert (construction) debris.

Person(s) who transport solid wastes or own / operate solid waste disposal facility must have a license from the Environmental Council of Zambia (ECZ) and comply with all Waste Management Regulations.

Applicable Regulations

PH Associates will not be assessing any solid waste disposal sites, but will identify each of the assessed facilities method of solid waste disposal. The following regulations are applicable to the transporters of solid waste.

License to Transport Solid Waste

- All commercial, municipal, or industrial facilities must posses a license to transport solid wastes offsite.
- During loading and transport, wastes cannot be scattered, flowing out, or emitting bad smells.
- · Vehicles must transport wastes along approved, scheduled routes.
- Transporter license may be valid from 6 months to 3 years depending on the transporters compliance with these regulations.

Page 13 50

Environmental Assessment APPENDIX D

THE PESTICIDES AND TOXIC SUBSTANCES REGULATIONS OF 1994

This regulation is part of the Environmental Protection and Pollution Control Act of 1990 and applies to person(s) intending to manufacture, import, export, improve, or process a "new" pesticide or toxic substance. The regulation includes specifications on product handling, use, storage, disposal, labeling, packaging, and worker health and safety issues.

Applicable Regulations

None. PH Associates will be assessing a pharmaceutical drug company that does not manufacture, import, export, improve, or process new pesticides or toxic substances.

P H Associates, Inc.
Page 14

APPENDIX D

ENVIRONMENTAL IMPACT ASSESSMENT REGULATIONS OF 1994

These regulations are part of the Environmental Protection and Pollution Control Act of 1990. The regulations require that a project brief and environmental impact study be performed for any new project, extension, repair, or maintenance of an existing project. This is to determine whether a project may have adverse or other significant impacts on the environment. Some of the projects that may require an environmental impact study include transportation, dams, mines, forestry, agriculture, industrial facilities such as refineries, tanneries, mineral and lime processing, foundries, breweries, motor assemblers, food processing, electrical substitutions, gas or fuel storage, and solid or hazardous waste disposal site.

Applicable Regulations

None. The environmental impact assessment regulations apply to new projects or existing projects where extension, repair, or maintenance occur. All facilities that PH Associates will assess are existing projects where there are no changes occurring, or operations which are closing down.

P H Associates, Inc.

Page 15

Environmental Assessment APPENDIX D

THE PETROLEUM ACT Chapter 424, Adopted 1930, numerous amendments up to 1969

The Act regulates the importation, conveyance, and storage of petroleum and other inflammable oils and liquids. This includes all petroleum, coal, schist, shale or other bituminous by-products. The Act requires licensing to transport or posses dangerous petroleum (gasoline, diesel etc.) and other dangerous petroleum. Dangerous petroleum transported on a public road must be in suitable and secure vessels that are certified and licensed by the Road Traffic Commissioner.

Licenses are required for possession of dangerous petroleum (exceeding 44 gallons) stored in non-inflammable storage sheds. A 55 foot buffer zone should surround the shed, and no storage sheds must be spaced less than 3 feet apart. Petroleum tanks located outside of sheds must be fenced with a 50 foot buffer zone.

Applicable Regulations

None. The Petroleum Act deals mainly with safety requirements and does not address underground storage tank or environmental issues such as storage tank integrity, leaks, or proper abandonment of tanks. Therefore, the Act does not apply to air, soil, or water pollution issues.

P H Associates, Inc.

THE PETROLEUM (EXPLORATION AND PRODUCTION) ACT No 13, Adopted 1985

This Act regulates petroleum exploration, development, and production in Zambia. It establishes a Petroleum Committee that regulates titles, contracts, and the control of petroleum operations prior to the export or entry into a refinery.

Applicable Regulations

None. The Act does not apply to petroleum depots, refineries, or gas stations, which are the type of sites to be assessed by PH Associates.

94 Page 17

THE AGRICULTURAL (FERTILIZERS AND FEED) ACT Chapter 351, Adopted 1990

This Act regulates and controls the manufacture, processing, importation, and sale of agricultural fertilizers and farm feed. It also provides effectiveness and purity standards for fertilizers and feed.

Applicable Regulations

None. The Act does not address the usage or disposal of fertilizers and feed at agricultural and livestock farms and therefore does not apply to any of the assessed sites.

55 Page 18

Environmental Assessment APPENDIX D

THE MINING (DUMPS) REGULATIONS Chapter 329, Section 132, Adopted 1972

These regulations provide guidelines for the maintenance of mine dumpings (consisting of solid or liquid materials) such as proper water drainage and diversion, and generally keeping the dump site stable. A designated Chief Mining Inspector regulates changes relating to the design and nature of the mine dumpings and requires periodic reporting from the management.

Applicable Regulations

The regulation does not address specific environmental issues on air, soil, and water pollution. There is one very general provision included in the regulation:

• Supervise/inspect site for the prevention of pollution of the surroundings or abatement of any nuisance.

P H Associates, Inc.

Environmental Assessment APPENDIX D

THE MINES AND MINERALS ACT Chapter 329, No 32 Adopted 1976 Amendments in 1981, 1984, and 1992

The Act determines the policy requirements for exploration, prospecting, and mining licenses and regulates the renewal and termination of mining rights. The amendments mainly deal with increased licensing, permit, and surveying fees. The Act requires proper sanitation and adequate water supply for workers, and many health and safety issues such as exposure and safe handling of inflammable, explosive, and radioactive materials.

Applicable Regulations

Environmental issues relating to air, soil, and water pollution, generated by surface and underground mining operations are generally not addressed by the Act, with the exception of the following:

- Avoidance of wasteful mining practices or wasteful metallurgic practices.
- Any effluent water discharged from any treatment or other process at a mine must comply with the provisions of the Water Act.

Reference can be made to the Water Act for specifics relating to discharged wastewater. The Mines and Minerals Act does have some mine siting criteria and abandonment requirements. However, these requirements do not apply to the existing (active) mine site to be assessed by PH Associates.

S 7 Page 20

APPENDIX D

REFERENCES

ENVIRONMENTAL COUNCIL OF ZAMBIA

Conditions Governing the License to Discharge Effluent and Wastewater, The Water Pollution Control (Effluent and Wastewater) Regulations, 1993

GOVERNMENT OF ZAMBIA

Agriculture (Fertilizers and Feed) 1990, Chapter 351 of the Laws of Zambia

GOVERNMENT OF ZAMBIA

Environmental Impact Assessment Regulations 1994, Environmental Protection and Pollution Control Act No 12 of 1990

GOVERNMENT OF ZAMBIA

The Environmental Protection and Pollution Control Act, No 12 of 1990

GOVERNMENT OF ZAMBIA

National Water Policy, 1994

GOVERNMENT OF ZAMBIA

The Mines and Minerals Act, 1976, Chapter 329 of the Laws of Zambia

GOVERNMENT OF ZAMBIA

The Mining (Dumps) Regulations, 1972, Chapter 329 of the Laws of Zambia, Section 132

GOVERNMENT OF ZAMBIA

The Pesticides and Toxic Substances Regulations, 1994. Environmental Protection and Pollution Control Act No 12 of 1990

GOVERNMENT OF ZAMBIA

The Petroleum (Exploration and Production) Acrt, 1985

GOVERNMENT OF ZAMBYA

The Waste Management (Declasing of Transporters of Waste and Waste Disposal Sites) Regulations, 1993 - Statuto: Instrument No 71 of 1993, The Environmental Protection and Pollution Control Act No 12 of 1990

GOVERNMENT OF ZAMBIA

The Water Pollution Control (Effluent and Wastewater) Regulations, 1993 - Statutory Insturment No 72 of 1993, The Environmental Protection and Pollution Control Act No 12 of 1990

REPUBLIC OF ZAMBIA

The Petroleum Act, 1930, Chapter 424 of the Laws of Zambia

REPUBLIC OF ZAMBIA

The Water Act, 1949, Chapter 312 of the Laws of Zambia

SANKWE M K

Environmental Council of Zambia, P O Box 35131, Lusaka, Zambia; telephone 224009; Personal Communication, May 19, 1995

P Il Associates, Inc.

Appendix E ENVIRONMENTAL ASSESSMENT CHECKLIST

CONFIDENTIAL

ENVIRONMENTAL ASSESSMENT CHECKLIST

Facility Zambia Steel & Building Supply LTD (Door Factory)
Location Kapatu RL, Lusaka

Date Assessed 5/15/95

Prepared for Zambia Privatisation Agency

CONFIDENTIALITY STATEMENT

This is an internal document, prepared by PH Associates, Inc., for the use of USAID.

The information contained in this document is confidential and proprietary in nature, and is to be used in conjunction with other facts and data for the sole purpose of providing information concerning potential environmental liabilities.

1.0 GENERAL INFORMATION

1.1 Facility Name ZSBS; Lusaka (Door Factory)

1.2 Locations(s) Head Office (trading & Storage); Buyantanshi Rd.
2) Door Factory; Box 3/509; Kapatu Kl
3) Timber Store (Former Woodtreatment Plant); Malambo Rd

1.3 Dates of Assessment(s) 5/15/55

1.4 Assessors

J. Holloway

2.0 FACILITY PROFILE

- 2.1 Address
- 2.2 Telephone 241277
- 2.3 Telex/TWX/Fax 246630
- 2.4 Facility Manager / Assessment Contact

 Mr. Singh / Gm
- 2.5 Individuals consulted as part of this assessment, including their affiliation and titles

NAME (S)	TITLE (S)
Mr. Singh	GM: 75BS Lusaka
Mr Kamuchele	Door Factory Manager
Mr. Banda	Production Supervisor; DorFeetery

2.6 Number of employees full time 30

Number of employees part time

- 2.7 Operational schedule (number of shifts / hours per day / days per week)
- 2.8 Total site area ZUO m 2
- 2.9 Total number of buildings 4 w/ awn. is 5

2.10 Facility inputs (raw materials, chemicals, fuels, lubricants, pesticides, etc)

Input	Quantity / Year
Lumber	?.
phywood	٦.
wood Addisives (the Addying)	21600 8/4-
Things	
Locquers	"
Varaishes Pant	", "

2.11 Describe facility production processes of environmental consequence

cutting, joining, gluing, sanding of various wood products

2.12 Facility products

Product	Quantity / Year
Flush Doors	80 000/4
Hardwood Doors	18 000/7
(off)	18 000/97
Fucaituce	? By confect
7 GI Me Fail	V

2.13 What sources of energy are used at the facility? (Electric) oil, coal, wood, charcoal)

No boilers, transformers

3.0 FACILITY HISTORY / LAND USE / PERMITS

- 3.1 Age of facility and date operations began 1965
- 3.2 Land use prior to current enterprise underelaped
- 3.3 Is there a history of potentially hazardous solid waste or waste water? 425
- 3.4 Any accidents or spills that may have resulted in environmental contamination? $y = \sum$

3.5 Do any environmental permits exist, and if so, is the facility in compliance?

NO

3.6 Review of the sites within one kilometer radius of the site and document other enterprises that may adversely affect the environment at the site through migration of contaminants or other mechanisms.

Facility Name	Location	Problems identified.
Match Corp. Ltd	300ME	Match Mensifacture
National Milliage Co.	2009 SE	m:11 - Co
United Bus Company of Rambia	200ME	Bus repair dopot
Steel Fabrications Ltd	100m E	Steel Fobrications
Kongtsu Ltd	10m South	Heavy equipment soles & repairs

3.7 Describe surrounding land use.

heavy industrial

3.8 Describe all operations and processes that are now closed down.

NONE

4.0 MANAGEMENT / DOCUMENTATION OF POTENTIALLY HAZARDOUS MATERIALS

4.1 Are any potentially hazardous raw materials or products stored and/or used onsite?

Y

Ν

List

Substance	Quantity	USE_	Lgth of Storage
Varnish	50l		ζ
Thinners	420.2		ζ.
Wood Adhesives	630 L		7.
Lacamer	50 1		· · ·
Paict	35l		7

4.2 Have there every been any incidents or accidents (spills) fires, injuries, etc) involving any of these materials?

(Y)

M

Describe

Varnish & wood achesive Spills in Furniture Production Area & Flush Door Production Area

Are incompatible materials segregated and labelled? 4.3



Describe

Are pesticides stored or used onsite? 4.4

Υ



List

Based on management knowledge, are there asbestos containing materials onsite? 4.5



Describe

pipe insulation, roof cheeting in Office & havehouse

Describe, in general, the level of environmental safety measures and practices at the site. 4.6

SOPPT

Review of records from the facility's Maintenance Department for documentation of 4.7 releases of potentially hazardous materials.

Not available

Review of any additional information and documentation concerning areas of 4.8 environmental concern.

Not available

AIR EMISSIONS 5.0

Total number of plant emission sources (stacks and vents) exhausting to the atmosphere. 5.1

1 Stack on Sawdust Cyclone - Sawdust emissions

5.2 Type of emission and discharge cycle from each source.

Source	Emission	Cycle (continuous, batch)
reclosor.	dust	3hs/dag
7000=		

5.3 Is there an air emission monitoring program?

Υ



Describe

5.4 Is there another source of air pollution nearby?

Υ

Ν

Distance

Describe Un Krown

5.5 Describe emissions in detail if applicable.

NO	enuir.	Problems	Rom	cyclone	em.'ss,600 S
					_

6.0 WATER / WASTEWATER DISCHARGES


6.1 Describe all sources and volumes of wastewater / effluent. List composition of wastewater.

Source	Volume	Composition
	7	Seu age
Lacare Aces	7	Water Winor Lacquer
Locquer. of they Surface Water Rumft	7	word water was Ladhes I
		Locquer varaish, paint
		<i>y</i> , , , , , , , , , , , , , , , , , , ,

Do chemical quality data exist for these sources? If yes, attach the results or describe the data.

Y





N Describe

process dains we stormwater drains to offsite ditch

Sonitary to Lusotta Water & Sewage Company Sewer

6.4 Is wastewater treated? If yes, describe the process:

Y N Describe

6.5 Does the facility have a pretreatment plant?

Y Describe type of pretreatment

6.6 Has wastewater ever been discharged to onsite lagoons, leach (soak away) fields, septic systems, spray irrigation, or other system?

Y Describe

6.7 Is the wastewater treated by the City Council and does this facility have limitations on quantity or quality of effluent that it will accept?

N Describe

6.8 Do any wastewater / effluent permits exist?

Y N Describe

6.9 Has the facility ever been inspected by permitting authorities?

Y N Describe

Chiefingector of Factories - bearter H&S. issues

6.10 Are there restroom facilities onsite and if so, do they discharge to a septic field or other system. What type of system?

N Describe

(r) N Describe

(discharge to LWSC Sewer; NO Septie tents

6.11 Have any of these systems ever been cleaned or filled?

Y N Describe frequency of clean / fill

7.0 WASTE HANDLING, STORAGE, TRANSPORTATION, AND DISPOSAL

7.1 List the facility solid wastes that are not known to be potentially hazardous (trash, scrap metal, palettes, etc)

Waste Type	Amount Generated
woodsciass	3
woodsciass Sandust' office xcash	
allica trach	
OFE	

7.2 Where are the non-hazardous wastes stored and disposed of?

recycled or goes to LWSC

7.3 Does the facility currently generate, store and / or dispose of potentially hazardous wastes?

N N

7.4 In the past, has the facility ever generated, stored or disposed of any potentially hazardous wastes? (Include onsite lagoons, landfills, incinerators or treatment systems.)



N

Unknown

With regard to 7.4 above, inventory of facility wastes (now or in the past) that are potentially hazardous. See 4.77.5

Waste Type / Storage	Amount Generated
Lubricants /	
Lubricants	
Oils (transformer, hydraulic)	
Oils (transionner, in)	
7	
Outropie dograpasers	
Solvents, degreasers	
A. i	
Paints, thinners	
1	
(aludaes plating wastes	
Process wastes (sludges, plating wastes, still bottoms, etc)	
Still Dottoms, etc)	
ψ	
Other waste storage or disposal	

Does the facility treat, or his it ever treated, potentially hazardous waste on site? 7.6

Describe

Is the facility licensed to treat these wastes? 7.7

Υ



Describe license

Is there any waste analysis plan in effect, including sampling / analyses prior to treatment, 7.8 storage and / or disposal?

Υ

Describe

Are potentially hazardous wastes shipped offsite? 7.9



Identify shipper and destination of wastes

Are any waste materials recycled or reused onsite?




Ν

List wastes and recycling processes

used chemical & process material Confiners

STORAGE TANKS 8.0



Inventory of storage tanks (aboveground and underground) 8.1

		Tank Material	Material Stored	Tank Age
Tank ID	Tank Siz^ (M3)	Tank Material	Wilderia	
			<u> </u>	
	1			

Are leak detection systems or groundwater monitoring systems employed? 8.2

Υ

N



Do the tanks meet any design requirements? 8.3

Υ

Ν

Describe



Have any tanks been pulled or abandoned? 8.4

Υ

Describe



POLYCHLORINATED BIPHENYLS 9.0



Have transformers ever been used onsite? 9.1

Υ

Ν

Describe

Have hydraulic or heat transfer oils ever been used on site? 9.2

Describe

Has any transformer, hydraulic, or heat transfer oil ever leaked or been spilled? 9.3

Υ

Ν

Describe

Has a survey ever been made to determine the presence or absence of PCB or PCB-9.4 contaminated oil in any operating or scrap units?

Υ

Ν

Describe

10.0 RADIOACTIVE MATERIALS

NONE

Are any wastes generated onsite which contain radioactive materials? 10.1

Υ

Ν

Describe

Are radioactive materials disposed of onsite or offsite? 10.2

Υ

Ν

Describe disposal methods, containment etc

12.0 NOISE

Does the facility generate high levels of noise?




Describe Cyclone makes Noice

Have there been any complaints regarding noise from neighbours? 12.2



Describe

13.0 EMERGENCY PLANS



Does the facility have an Emergency Plan covering environmental emergencies and involving local authorities?

Ν

Describe

Does the facility have an emergency response team? 13.2

Υ

Ν

Describe

14.0 ENVIRONMENTAL SETTING

14.1 Describe topography (flat terrain, valley, vegetation).

Facility completely powed w/ workete, Flat

14.2 Soils / geology

> 14.2.1 Have soil borings and sampling activities ever been conducted? If yes, how many and describe:



Unknown

	14.2.2 I	s there any obser	ved soil contami	nation at the site	?			
	`	y N	Unkn	own				
14.3	Ground	water / hydrogeol	ogy					
	14.3.1 [Depth to groundw	rater Untime					
	14.3.2	s there evidence	that groundwate	r is affected by p	ollution?	1.6/2		
	14.3.3 Location of all operating and abandoned onsite wells (provide map if possible).							
	14.3.4	Nell / borehole in	formation (all op	erating and aban	doned wells / bo	reholes).		
V	Vell	Date Installed	Diameter	Depth	Pump rate	Yield per day		
		NC	NE					
14.3.5 Have any groundwater samples ever been taken and analyzed? Y N U If yes, provide most recent results								
	14.3.6	Have any ground	water studies be	en carried out?	(ie pumping test	s etc)		
	,	Y	U	Are the	ey available?			
14.4	Site dra	inage and surfac	e water					
	14.4.1	Are there any sur area?	face water bodie	s known to be co	ontaminated by a	any source in this		
		Y N	Des	cribe				

14.4.2 How is rain / storm water collected, where does it flow, and is there flooding during
the rainy season? (placeted in Stormwater Collection
drains that discharge into offsite unlined drainage ditch; water infiltrates into subswitere 14.4.3 Any potential for adverse impacts to stormwater runoff due to operations or waste
ditch; water infiltrates into subsurface
14.4.3 Any potential for adverse impacts to stormwater runoff due to operations or waste
management practices at the facility?

14.4.4 Is there potential for rain to fall directly onto chemicals or other materials that might have an effect on soils or groundwater?

15.0 ADDITIONAL COMMENTS AND SKETCH OF SITE

SUMMARY OF ATTACHMENTS REQUESTED 16.0 Check items received

Site maps of the facility identifying buildings, structures, and drainage details for inclusion in our report Y Aerial photographs Y Process flow diagrams for each process at the facility Materials/Chemical inventory listing including quantities stored onsite, onsite use, and monthly usage and disposal rate Copies of all environmental permits (discharge, e'c.) Υ Data concerning any releases or spills of materials/chemicals at the facility Y Address and type of industry listing of enterprises neighboring your facilities Y Ν Copy of laboratory analyses of process waste streams (liquid and solid) Y Underground storage tanks; construction details, number, capacities, and use Y

Any information about the geologic and groundwater conditions at the facilities (i.e. soil types, depth to groundwater, onsite wells including depth, production, construction details, and groundwater laboratory analyses, etc.)

Y

Appendix F FACILITY RECORDS

11th October, 1989.

The General Manager, ambia Steel and Building Supplies Limited, ... ox 31509, https://doi.org/10.1009/pubm.

Dear Sir.

moor 15

ingested.

iding he

~ ette shere.

FACTORIUS ACT S.B. 514 OF THE LANS OF A 1.

I refer to my recent visit together with Fr. J. Actube, to your timber division factory on 4th October, 1989. The following matters which were noted require your attention:

FOUTTH BY TOUTHER ERY

Unuld you provide guards to the following machinery

- 1. Oringing stones in the tool room >
- ... Ves belt and driving bulley
- 5. Top guard, riving knife for circular saw ho. 3 x
- E. Ripping machine (circular saw) needs top and botton permanent guards, and riving knife
- 5. Guards for circular saw on Temener machine. If blude crucks and splinters fly off, they could nurt someone
- 6. Novable guard at end of belt and pulley on satisfy χ machines
- 7. Chain and sprocket need guard on Trimmer machine as well as pulleys and moving chains need complete guards $^{\times}$ at ends. Its circular saws should be guarded
- č. Twin cutter No. 31 needs guards for circular saws ✓
- 9. Circular saw No. 35 needs top guard and a riving knife x
- 10. Four cutters No. 28 and 29 need guards for all dangerous moving parts pulleys, belts, sprockets, chains and gears.
- 11. Same as in (10) for five cutter No. 30 machine
- 12. Radial cutter No. 27 needs guard for circular saw X
- 13. Door Planing Machine needs guard for blade

14

VENTILATION AND LIGHTING

Could you improve exhaust ventilation in the spraying area as there is a lot of chemical fumes. Your present exhaust is not working.

Suction -

PROTECTIVE APPLIANCES AND CLOTHING

workers at Trimmer Machine need goggles to protect their eyes from flying particles.

L'CTRIC'L

rovide a better clamp for the welding machine in tool room. The cable for fluorescent tube in stores is not suitably insulated. Proper insulation should be provided. Valid arm No. 6 cables need to be properly done as well.

FIRE PRECAUTIONS

Thinners, varnish, and PVA in stores could cause a bir fire therefore could you provide more suitable fire cutinguithere instead of one.

INDEAN FUMLE.

lmost all the dust extractors from the wood working machines \checkmark are not connected. Could you please see to it that all these are connected and in working order.

... ING FACILIFIES, DRINKING WATER

There are no shower rooms for workers to take showers after work. Make arrangements for the availability of showers.

. COLDENT REPORTING

Te have not been receiving accident reports from you. Flease ensure that from now all accidents in the factory that cause loss of life to a person employed on disables any such person for more than three days from earning full wages, should be reported promptly on Lab Form F/6 to this office.

REGISTERS, NOTICES AND FORMS UNDER THE ACT

Obtain the Abstract of the Act and the Electric Shock Treatment posters from Government Printer, Lusaka, and post them in prominent places in the ractory.

/3.....

Yours faithfully,

Belaonga

B. Kaonga INSPECTOR OF FACTORIES.

- c.c. The Chief Inspector of Factories,
 Ministry of Labour, Social Development and Culture,
 Department of Factories,
 Lechwe House,
 P.O. Box 32186,
 LUSAKA.
- c.c. The Factory Manager,
 Zambia Steel and Building Supplies Limited,
 F.O. Box 31509,
 LUSAKA.

BK/rb.